



Obsolete Modified Hydro Vent Cap

Subject: Discontinue using the Modified Hydro Vent Cap P/N36410011

Units

Affected: All units below the serial range shown.
 WSES/RH, serial # 48968 and below
 WS small frame, VK Hydro PG, serial # 48979 and below
 WSZK, serial # 48983 and below
 WSE, serial # 49062 and below

Situation: Units that had the vent caps leak used a modified vent cap to resolve the issue. The modified cap still showed signs of leaking.

The Fix: If unit has oil leaking from vent cap, replace the hydro tank with the new hydro tank service kit. (See Chart)

Model	Kit p/n's	Included in Kit	Part Description
WSRH	95420005	HYDRAULIC TANK SERVICE KIT, RH	
		93410114	HYDRO TANK, SPORT/RH
		36410006	HYDRO TANK VENT CAP
		35410060	PLUG, 3/8 PIPE
WSES	95420004	HYDRAULIC TANK SERVICE KIT, SPORT	
		93410114	HYDRO TANK, SPORT/RH
		35410061	VENT, BREATHER, 3/8" NPT, MALE
		35410060	PLUG, 3/8 PIPE
WSE 3	95420003	HYDRAULIC TANK SERVICE KIT, WSE III	
		91420006	HYDRO TANK, WSE III
		36410006	HYDRO TANK VENT CAP
		35410060	PLUG, 3/8 PIPE
SM WS & VK PG	95420002	HYDRAULIC TANK SERVICE KIT, WV AND STX	
		91420007	HYDRO TANK WELDMENT, SM. WS
		36410006	HYDRO TANK VENT CAP
		35410060	PLUG, 3/8 PIPE
WZK	95420006	HYDRAULIC TANK SERVICE KIT,WZK	
		91420012	HYDRO TANK WELDMENT, WZK
		36410006	HYDRO TANK VENT CAP
		35410060	PLUG, 3/8 PIPE

P/N's

Affected: 36410011 – Hydro Tank Vent Cap, Service Part Only