



RECALL Bulletin 009
Page 1 of 2
April 20, 2011 / Rev2

Defective Roll-Over Vent

Subject: Faulty operation of Roll-over vents on 2011 EPA compliant fuel tanks.

Units

Affected: Any WS, WSTX, WSR, WSES, WVP and WVGD serial number 54956 to 55763.
Any WSZK serial number 55138 to 55763
Any WZ serial number 55142 to 55763

Situation: The vent membrane fails if the membrane becomes saturated with gas, causing vacuum build up in the fuel tank and shut down of the engine. Each affected unit will be required to have this recall performed.

Incidents

Injuries: WMI has received several reports of engine shut downs. WMI has **not** received any reports of fires or injuries; however, WMI strongly recommends any and all affected units be in compliance prior to retail sale.


The Fix: Replace 45410009 vent with 45410020 check valve vent. A new grommet will be included with the new vent.

Claim

Procedure: File an on-line warranty claim; do not include any other warranty work on this recall claim. Select "Service Recall" for Claim Type. For "Service Recall #", type RB009. The claim must be filled out completely. In the "Failed Part No" field, type 45410009, and type 45410020 in the "Part Used" field. This information is very important for tracking purposes. .25 hr of labor allowed per vent. **FAULTY VENTS NEED TO BE RETURNED TO WRIGHT MFG SEPARATILY; DO NOT INCLUDE ANY OTHER PARTS.**

Ship to Wright Mfg. via UPS using UPS account number 09RW64 (this will bill the freight charges to Wright Mfg.) DO NOT DECLARE A VALUE ON THE PARTS and DO NOT EXPEDITE THE SHIPMENT.

Faulty
Roll-over vent
PN 45410009

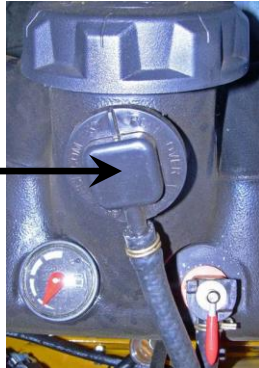


NEW
Roll-over vent
PN 45410020



Grommet and Vent Installation Instructions

These instructions will cover both single and dual fuel tank mowers

1. Remove fuel line from vent.
2. Remove faulty vent and grommet.
3. Install new grommet into fuel tank.
4. Apply lube to the new vent and push into grommet.
5. Attach fuel line.

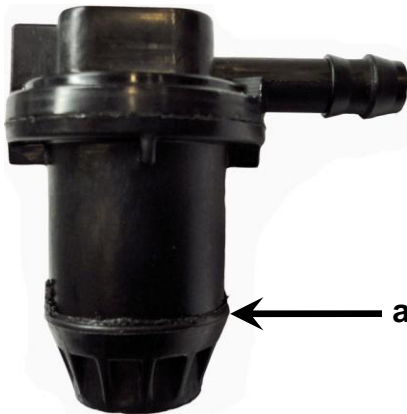

Apply small
amounts of oil
or grease